Verified RealEstate™

REFERENCE
02/2026-2027

ISSUED
08 May 2026

PP APPROVAL RECORD

# Planning Permission

Coimbatore district, Tamil Nadu

APPROVAL TYPE
**Building Plan**

ISSUING AUTHORITY
**Rural Panchayat**

The approval as the planning authority issued it, reproduced in full behind this page.


An approval speaks to what was sanctioned, not to what was built. Completion is a separate record.

Verified RealEstate™
3/350/2 Mettukuppam,
OMR Thoraipakkam,
Chennai 600 097, India


hello@verified.realestate
+91 9996 12 9996
verified.realestate

DIGITALLY VERIFIED RECORD


# PLAN SHOWING THE PROPOSED CONSTRUCTION OF GROUND FLOOR R.C.C ROOF COMMERCIAL BUILDING IN S.F.NO - 102 / 4 , SITE NO - 31 , PATTA NO : 2281 , MURUGAN NAGAR , KARIYAMPALAYAM VILLAGE , ANNUR TALUK, COIMBATORE DISTRICT.
# APPROVED LAYOUT NO - 1771 /2016/ A1 .

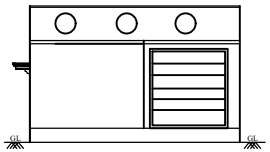



**ELEVATION**

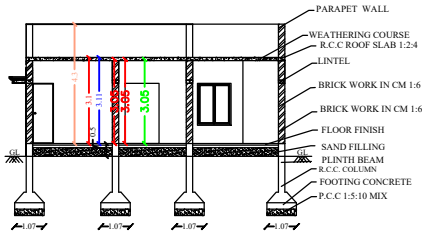


**SECTION ON AA**



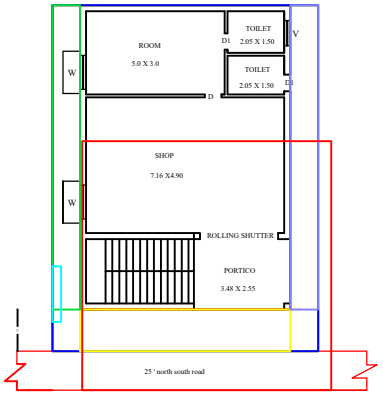
## Essential Elements for Earthquake Safety:-

The Essential Elements required to make a Building Earthquake Safe are as given in Figure-1.


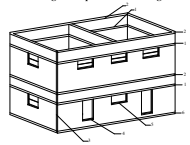



Figure - 1 :Essential Internal Elements in Buildings for Earthquake Safety.




a. Section of the Band with 2 Longitudinal steel bars
b. Section of the Band with 4 Longitudinal steel bars
c.Structural Plan at L-Type wall Junction
d.Structural Plan at T-Type wall Junction

1. Longitudinal Reinforcements
2. Lateral Ties
3. Vertical Reinforcement at corners

b.b1,b2 Wall Thickness


Figure - 2 : Reinforcement and Bending Details of Seismic Bands.





a & b . Alternate Courses in one Brick wall
1 : one Brick Length
½ : Half Brick Length
¼ : Quarter of a Brick Length
¾ : Three Quarters of a Brick Length


3. Vertical Reinforcement bars with Concrete/ Mortar Filling in Pocket of M20 Grade ( 1:1 1/2 :3)

Figure - 3 : Typical Details of Providing Vertical Steel bars in Brick Masonry.

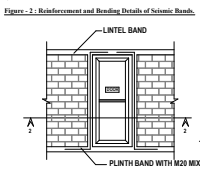


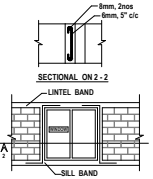

## DETAILED DRAWING FOR SEPTIC TANK WITH DISPERSION TRENCH 225 GALLONS CAPACITY OF 1000 LITRES

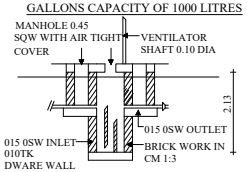



SECTION OF SEPTIC TANK

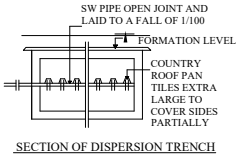



SECTION OF DISPERSION TRENCH




PLAN OF SEPTIC TANK





PLAN OF DISPERSION TRENCH

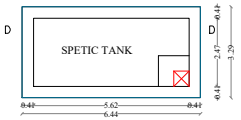


PLAN OF SEPTIC TANK
SCALE 1"-2'0"




WICKET GATE




MAIN GATE

| AREA DETAILS | IN SFT | IN SQ. M. |
|---|---|---|
| F THE SITE | 1296.00 | 120.40 |
| F THE PROPOSED GROUND FLOOR | 899.86 | 83.60 |
| F THE OPEN SPACE | 396.14 | 36.80 |

## JOINERY DETAILS

| Sym. | DESCRIPTION | IN FEET | |
|---|---|---|---|
| MD | MAIN DOOR | 3' 6" X 7' 0" | 1.07 X 2.13 |
| D/O | DOOR / OPEN | 3' 3" X 7' 0" | 1.00 X 2.13 |
| D1 | DOOR | 2' 6" X 7' 0" | 0.76 X 2.13 |
| W | WINDOW | 6' 0" X 4' 6" | 1.82 X 1.37 |
| W1 | WINDOW | 4' 0" X 4' 6" | 1.22 X 1.37 |
| V | VENTILATOR | 4' 0" X 2' 6" | 1.22 X 0.76 |

HORIZONTAL DISTANCE FROM HT.LINE IF ANY - NIL.

PERCOLATION PIT @ 10' c/c

ALL METREIC DIMENSION ARE IN "m"

| Plan, Section & Elevation | Site Plan |
|---|---|
| SCALE 1" : 8' 0" | 1" : 8' 0" |

SITE BOUNDRY
PROPOSED BUILDING
EXISTING ROAD

N

SHEET_1

.....RAJ . S
S/O SENTHURAPANDI
848 B , RMR AVENUE , ELLAPALAYAM ,
KARIYAMPALAYAM ,
ANNUR 641653

Applicant


Er P VINEETH DCE ., BE., RE G II
SRI VINU BUILDERS , ANNUR
Ph : 98422 73735

Er. P.VINEETH D.C.E.,B.E.,LBS.,
Sri Vinu Builders
ENGINEERS & CONTRACTORS
74/5, AMS Complex, SBI (Opp), 1st Floor, Sathy Road,
Annur - 641 653. Coimbatore.
Mob : 98422 73735 | Off : 04254 262152
Regd Engineer

THE LANDLENS SUITE

# Eight ways to know a piece of land before you pay for it.

This report covers one part of the picture. These cover the rest, drawn from the same government records, for any property in Tamil Nadu.

### LandLens One
Ask anything about a property and get an answer grounded in live government records, with the sources shown.
**/landlens/one**

### Verify My Land
Every record check run on one property and returned as a single report.
**/landlens/verify-my-land**

### Legal Opinion
An advocate's written opinion on the title, built on the records we pull for it.
**/landlens**

### One Map
Every layer on one map: the parcel, its boundary, zoning, water bodies and what sits around it.
**/landlens/one/map**

### PriceMap
What land actually changed hands for around this plot, taken from the registered deeds.
**/landlens/pricemap**

### Build Scope
What you are allowed to build here: floor space, height, coverage and setbacks.
**/landlens/build-scope**

### Property Tracker
Watch a property and hear about it when something new is registered against it.
**/landlens/property-tracker**

### Deal Room
Run the transaction in one place: documents, stamping, signatures and the parties.
**/landlens/deal-room**

FREE TOOLS · NO ACCOUNT NEEDED

# Twenty-four checks you can run yourself, at no cost.

## Records and verification

The registers themselves, read for you.

- Encumbrance Certificate
- Patta and Chitta
- Field Measurement Sketch
- EC Analyzer
- Bank charge check
- Court case search
- Seller background check
- Approval check by survey

## Value and duty

What it is worth and what it costs to register.

- Guideline value by street
- Guideline value by survey
- Stamp duty and registration fees
- Capital gains
- Floor space index
- Area unit converter

## Zoning and land use

What the plan says can happen on this land.

- Land use zone finder
- CMDA land use check
- Coastal regulation zone
- Master plan check
- Water bodies finder
- Airport height clearance

## Registers and directories

Who holds it, and which office keeps the record.

- Find your registering office
- Temple property check
- Waqf property check
- RERA register

**Every free tool**
/tools

**Services we run for you**
/services

**The LandLens suite**
/landlens/one

Verified RealEstate™

# Every claim in this document traces back to a government record.

- Legal opinions, due diligence and title verification
- Building plan, layout and sub-division approvals
- Completion and occupancy certificates, regularisation
- Escrow, negotiation and NRI property management
- Land survey, soil testing, architecture and construction

**Verified RealEstate**
3/350/2 Mettukuppam,
OMR Thoraipakkam,
Chennai 600 097, India
**hello@verified.realestate**
+91 9996 12 9996

Prepared from the registers named on the page each finding sits on. Where a register could not be read, this document says so in its place rather than leaving the gap to be read as a clean result.