PP APPROVAL RECORD

Planning Permission

Periyakottai
Dindigul district, Tamil Nadu

APPROVAL TYPE
Building Plan

ISSUING AUTHORITY
Rural Panchayat

PURPOSE
Commercial

The approval as the planning authority issued it, reproduced in full behind this page.

An approval speaks to what was sanctioned, not to what was built. Completion is a separate record.

Verified RealEstate™
3/350/2 Mettukuppam,
OMR Thoraipakkam,
Chennai 600 097, India


hello@verified.realestate
+91 9996 12 9996
verified.realestate

. PLAN SHOWING THE PROPOSED CONSTRUCTION OF 1A,1B COMMERCIAL GROUND FLOOR ACC TRUSS GODOWN BUILDING IN WARD NO:10,S.F.NO : 709/1B1, 710/4B1, PATTA NO : 1111 AT KOVILUR PIRIVU,PERIYAKOTTAI VILLAGE & PANCHAYAT, DINDIGUL EAST TALUK, DINDIGUL DISTRICT.


. SCALE : [1:100]

All Dimensions Are In Meters


APPLICANT NAME : Mr. S.VELLAICHAMY,
S/o. SOMANCHETTIYAR

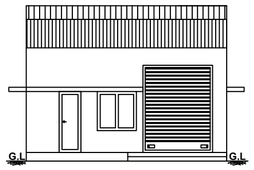


. FRONT ELEVATION .

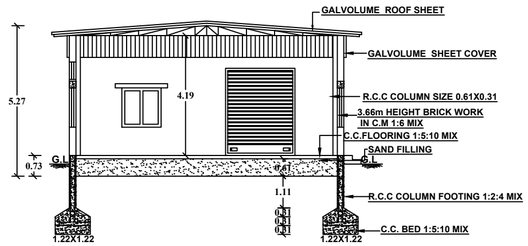


. SECTION ON "AB" .

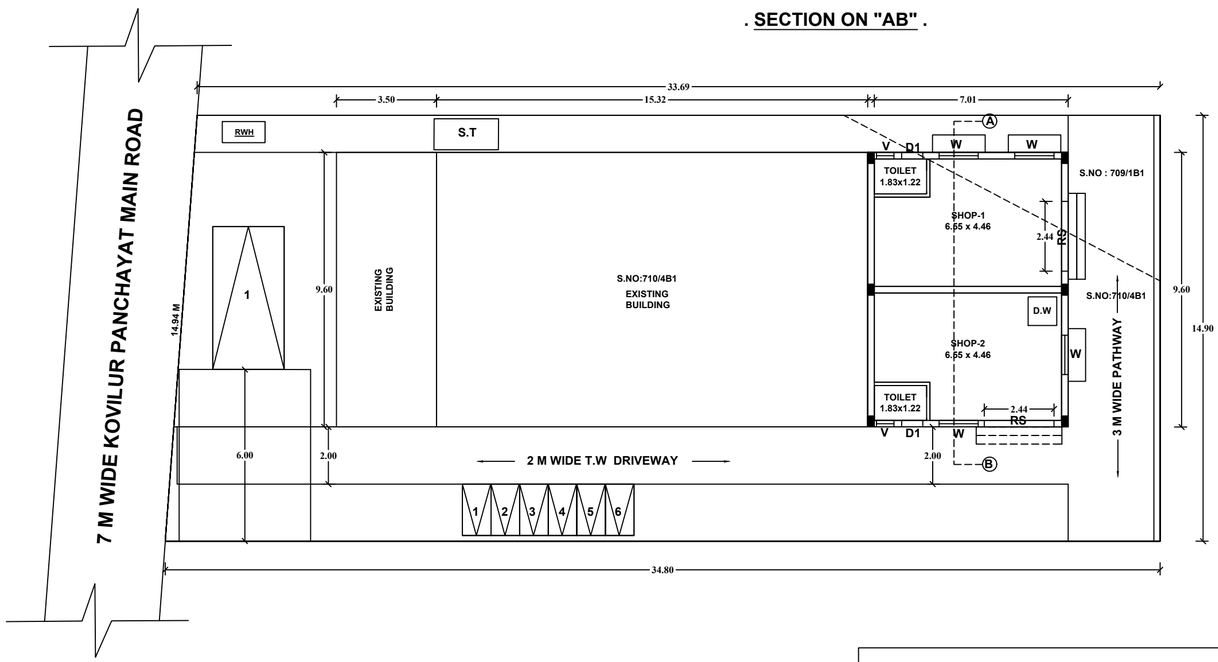




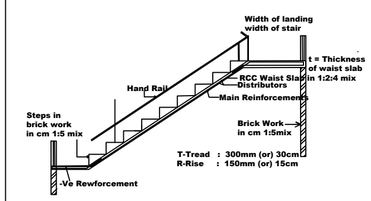


TYPICAL CROSS SECTION OF STAIRCASE DETAILS (NOT OT SCALE)



Note:
Registered Doc No : 5059/03.09.1998
Patta No : 1111




. SECTION ON RAIN WATER COLLECTION TUB .

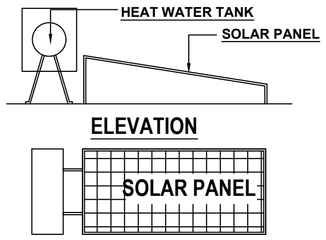


ELEVATION

PLAN

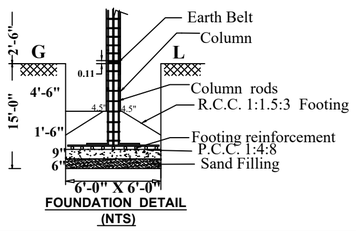

FOUNDATION DETAIL (NTS)




TRIAL PIT

APPLICANT :

S.VELLAICHAMY
S/O.SOMANCHETTIYAR


KEY PLAN
(Not To Scale)

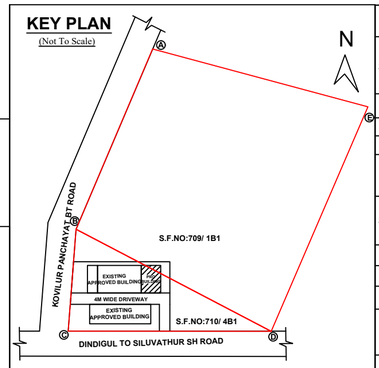

. SPECIFICATION .

. FOUNDATION	: R.C.C COLUMN FOOTING 1:1.5:3 MIX OVER A BED OF C.C 1:4:8 MIX.
. BASEMENT	: R.C.C COLUMN FOOTING 1:1.5:3 MIX, BRICK WORK IN C:M 1:6 MIX.
. SUPERSTRUCTURE	: BRICK WORK IN C:M 1:6 MIX.
. ROOFING	: R.C.C ROOF BEAMS & ROOF SLAB 1:1:2 MIX, 0.12M THICK
. JOINERIES	: STEEL ROLLING SHUTTERS, WINDOW GRILL, PVC TOILET DOORS,UPVC WINDOWS.
. FLOORING	: C.C FLOORING 1:4:8 MIX 0.33 THICK AND TOP FINISHED WITH C:M 1:3 MIX, 0.23 TK.
. PLASTERING	: CEMENT PLASTERING 1:5 MIX, 0.15 TK.
. USE	: COMMERCIAL BUILDING.

R.C.C. COVERING SLAB 1:2:4 MIX 0.11 THICK

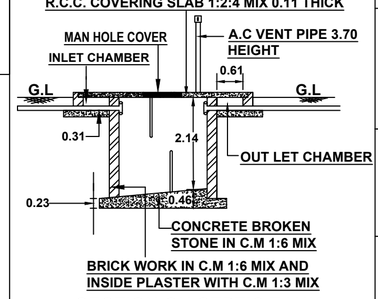

.SECTION ON SEPTIC TANK .

. REFERENCE.

SITE BOUNDARY

PROPOSED BUILDING

LICENSED BUILDING SURVEYOR :

Er.A.SHEIK PHAREETH D.C.E.,
LICENCED BUILDING SURVEYOR,
A.S.P CONSTRUCTION
CONSULTING CIVIL ENGINEER,
15-3-40,15th Ward,Pleespuram Street,
Batlagundu Post,Nilakottai Taluk,
Dindigul-624202.
Phone No : 99443 18700.

TOTAL SITE AREA DETAILS:-

SL.NO	SURVEY NUMBER	AREA (Sq.Mt) (As Per Patta)	AREA (Sq.Mt) (As Per Document)
1	709/1B1	7700.00	7700.00
2	710/4B1	1750.00	1750.00
	TOTAL	9450.00	9450.00

BUILTUP SITE AREA DETAILS:-

SL.NO	SURVEY NUMBER	AREA (Sq.Mt)
1	710/4B1	478.21
2	709/1B1	32.08
	TOTAL	510.29

FLOOR	FSI SQMT	NON FSI SQMT	TOTAL SQFT
PRO.GROUND FLOOR	67.31	-	67.31
	67.31	-	67.31

PLOT COVERAGE (PC) = $\frac{67.31}{9450.00}$ X100 = 0.71%

SCHEDULE OF JOINERIES

S.NO.	DESCRIPTION	FEET	METRE
D1	DOOR	3'0" X 7'0"	0.91 X 2.13
RS	ROLLING SHUTTER	8'0" X 7'0"	2.44 X 2.13
RS-1	ROLLING SHUTTER-1	16'0 X 7'0"	4.88 X 2.13
W	WINDOW	4'6" X 4'6"	1.37 X 1.37
W1	WINDOW 1	3'0" X 4'0"	0.91 X 1.22
V	VENTILATOR	3'0" X 2'0"	0.91 X 0.61

PARKING DETAILS:

CAR PARKING SIOT : 1Nos
TWO WHEELER PARKING SLOT : 6 Nos

OFFICE USE:

Drawing Scrutiny Ref No : KKRBLWP6
Online Application No : SWP/BPA/433763/2024
ROC No : 011/2024-2025/BPA
Building Plan Permission No : 011/2024-2025/BPA

PERIYAKOTTAI VILLAGE & PANCHAYAT,
DINDIGUL EAST TALUK,DINDIGUL DISTRICT.

REGISTERED ENGINEER :

Er.N.KISHORE PRAKASH B.E., M.E.,
Registered Engineer - Grade III
LPA Registration No : 06/2024
RISHI CONSTRUCTION
Subam Complex, Nallampatty Pirivu,
Adiyanuthu (Post),Dindigul-624 003.
Phone No : 97904 35390,
89039 77121

THE LANDLENS SUITE

Eight ways to know a piece of land before you pay for it.

This report covers one part of the picture. These cover the rest, drawn from the same government records, for any property in Tamil Nadu.

LandLens One
Ask anything about a property and get an answer grounded in live government records, with the sources shown.
/landlens/one

Verify My Land
Every record check run on one property and returned as a single report.
/landlens/verify-my-land

Legal Opinion
An advocate's written opinion on the title, built on the records we pull for it.
/landlens

One Map
Every layer on one map: the parcel, its boundary, zoning, water bodies and what sits around it.
/landlens/one/map

PriceMap
What land actually changed hands for around this plot, taken from the registered deeds.
/landlens/pricemap

Build Scope
What you are allowed to build here: floor space, height, coverage and setbacks.
/landlens/build-scope

Property Tracker
Watch a property and hear about it when something new is registered against it.
/landlens/property-tracker

Deal Room
Run the transaction in one place: documents, stamping, signatures and the parties.
/landlens/deal-room

FREE TOOLS · NO ACCOUNT NEEDED

Twenty-four checks you can run yourself, at no cost.

Records and verification

The registers themselves, read for you.

- Encumbrance Certificate
- Patta and Chitta
- Field Measurement Sketch
- EC Analyzer
- Bank charge check
- Court case search
- Seller background check
- Approval check by survey

Value and duty

What it is worth and what it costs to register.

- Guideline value by street
- Guideline value by survey
- Stamp duty and registration fees
- Capital gains
- Floor space index
- Area unit converter

Zoning and land use

What the plan says can happen on this land.

- Land use zone finder
- CMDA land use check
- Coastal regulation zone
- Master plan check
- Water bodies finder
- Airport height clearance

Registers and directories

Who holds it, and which office keeps the record.

- Find your registering office
- Temple property check
- Waqf property check
- RERA register

Every free tool
/tools

Services we run for you
/services

The LandLens suite
/landlens/one

Verified RealEstate™

Every claim in this document traces back to a government record.

- Legal opinions, due diligence and title verification
- Building plan, layout and sub-division approvals
- Completion and occupancy certificates, regularisation
- Escrow, negotiation and NRI property management
- Land survey, soil testing, architecture and construction

Verified RealEstate
3/350/2 Mettukuppam,
OMR Thoraipakkam,
Chennai 600 097, India
hello@verified.realestate
+91 9996 12 9996

Prepared from the registers named on the page each finding sits on. Where a register could not be read, this document says so in its place rather than leaving the gap to be read as a clean result.