PP APPROVAL RECORD

Planning Permission

Erode district, Tamil Nadu

APPROVAL TYPE
Building Plan


ISSUING AUTHORITY
Rural Panchayat

The approval as the planning authority issued it, reproduced in full behind this page.


An approval speaks to what was sanctioned, not to what was built. Completion is a separate record.

Verified RealEstate™
3/350/2 Mettukuppam,
OMR Thoraipakkam,
Chennai 600 097, India


hello@verified.realestate
+91 9996 12 9996
verified.realestate

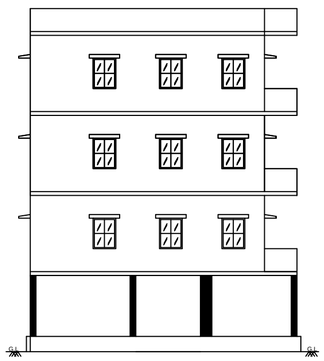


FRONT ELEVATION

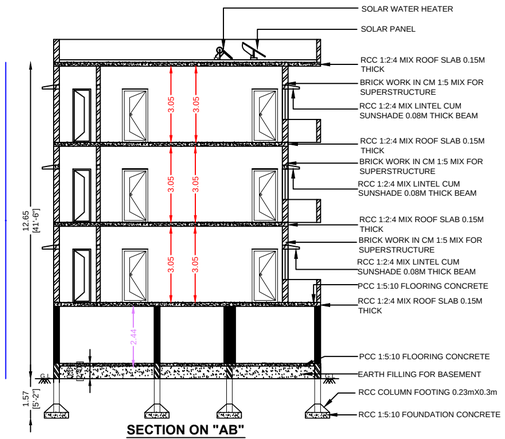


SECTION ON "AB"

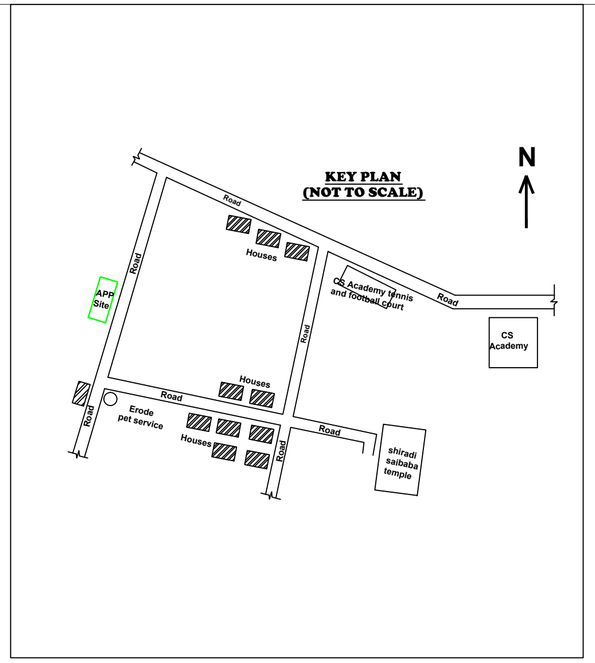


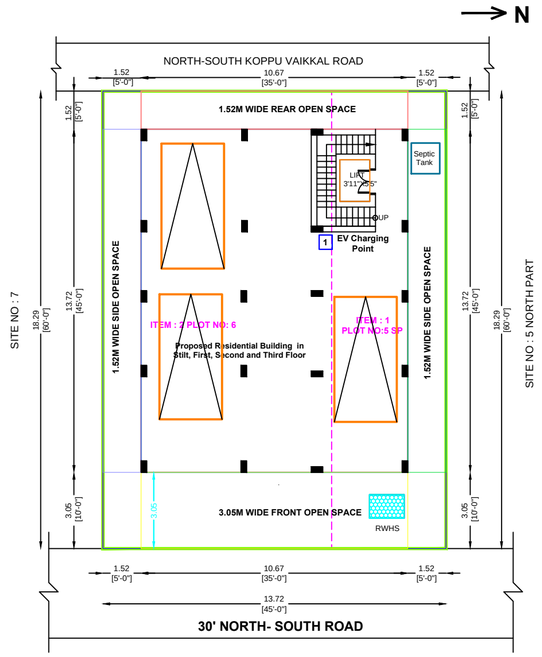


SITE PLAN (SCALE 1:100)

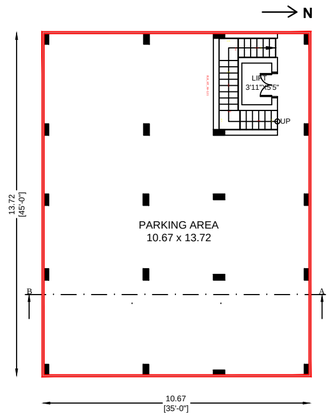


STILT FLOOR PLAN

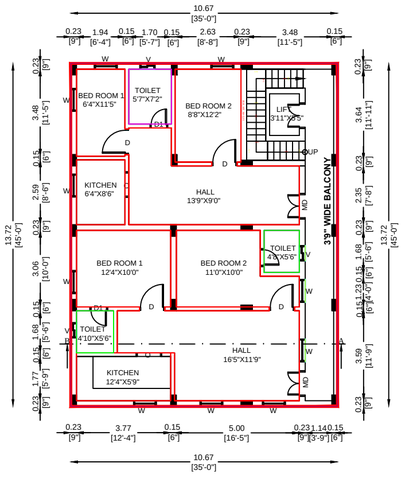

FIRST FLOOR PLAN

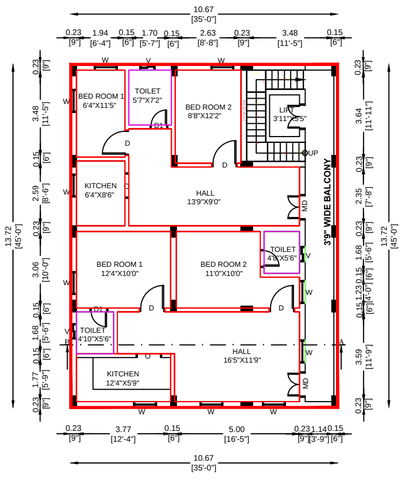


SECOND FLOOR PLAN

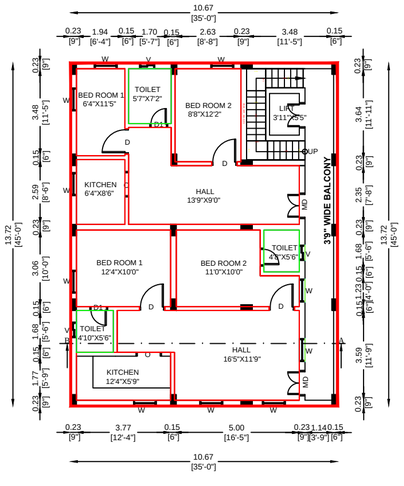


THIRD FLOOR PLAN


PLAN OF SEPTIC TANK & DISPERSION TRENCH CAPACITY OF 2500 LITTERS.

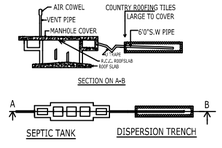


RAIN WATER COLLECTING PIT BORE WELL RAIN WATER HARVESTING SYSTEM

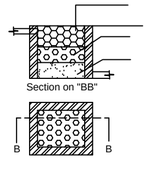

STAIRCASE DETAILS

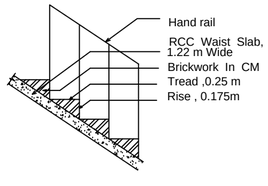

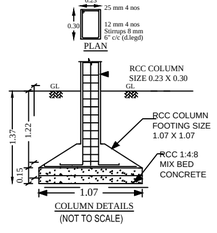

COLUMN DETAILS
(NOT TO SCALE)

PLAN INFO
PLOT_AREA_M2= 250.83
AS_PER_DOCUMENT = 250.83
SINGLE_FAMILY_BLDG=NO
CRZ=NO
SECURITY_ZONE=NO
WHETHER_GOVT_OR_AIDED_SCHOOL=NO
DISTRICT=ERODE
TALUK=PERUNDURAI
JURISDICTION_TYPE=PANCHAYAT
SURVEY_NO= 3/4A1C
PATTA_NO=1957
PLOT_NO= 5 SP AND 6 NP
ACCESS_WIDTH_M=13.72
ROAD_WIDTH=9.14
ROAD_LENGTH=250.00
AVG_PLOT_WIDTH= 13.72
AVG_PLOT_DEPTH= 18.29
LAND_USE_ZONE =RESIDENTIAL
RWH_DECLARED=YES
BUILDING_NEAR_TO_RIVER=NO
AREA_TYPE=OTHERS
BUILDING_NEAR_MONUMENT=NO
BUILDING_NEAR_GOVT_BLDG=NO
NOC_FOR_CONSTRUCTION_NEAR_MONUMENT=NO
NOC_FIRE_DEPT=NO
OSR_APPLICABLE=NO
OSR_SURRENDER=NO
OSR_SURR_BUYBACK_RETAIN=BUYBACK
PREMIUM_FSI_REQUIRED=NO
IS_APPROVED_LAYOUT=NO
IS_SWIMMING_POOL_EXISTS=NO
IF_HERITAGE_TOWN_LESSTHAN_1KM_RADIUS=NO
FMB_OR_PLR = 250.83
AS_AT_SITE =250.84

PLAN SHOWING THE PROPOSED CONSTRUCTION OF RCC TERRACED ROOF RESIDENTIAL BUILDING IN STILT, FIRST, SECOND AND THIRD FLOOR AT PLOT.NO:5 SOUTH PART, PLOT.NO: 6 NORTH PAR T, **"SRI THIRUPATHI GARDEN"** IN R.S.F.NO 3/4A1C, KAVUND ACHIPALAYAM VILLAGE AND PANCHAYAT, PERUNDURAI TALUK, ERODE DISRTICT.

APPLICANT:


Mr.G.SATHISKUMAR, S/o.Mr.(LATE)GOVINDASAMY

S.NO	AREA DETAILS	SQ.MT.	SQ.FT.
1.	Area of the Site	250.84	2700.00
2.	Plinth area of the Proposed RCC Roof Residential Building in Stilt floor	146.32	1575.00
3.	Plinth area of the Proposed RCC Roof Residential Building in First floor	146.32	1575.00
4.	Plinth area of the Proposed RCC Roof Residential Building in Second floor	146.32	1575.00
5.	Plinth area of the Proposed RCC Roof Residential Building in Third floor	146.32	1575.00
6.	Total plinth area of the Proposed RCC Roof Residential Building in Stilt, First, Second and Third Floor	585.28	6300.00
7.	Area of the Open space	104.52	1125.00
8.	Carpet area of the Proposed RCC Roof Residential Building in First, Second and Third.floor	243.90	2625.33

SCALE :- 1 : 100
ALL DIMENSIONS ARE IN METRIC & FEET
ALL ROOMS ARE HAVING SUFFICIENT VENTILATION

JOINERIES:

DOOR	MD	- 0.91 X 2.13
DOOR	D	- 0.91 X 2.13
DOOR	D1	- 0.76 X 2.13
WINDOW	W1	- 0.91 X 1.22
WINDOW	W	- 1.52 X 1.22
OPENING	O	- 0.91 X 2.13
VENTILATOR	V	- 0.61 X 0.60



INDEX:

1. APPLICANT SITE BOUNDARY SHOWN IN -
2. PROPOSED RCC BUILDING SHOWN IN -
3. EXISTING ROAD SHOWN IN -
4. RAINWATER HARVESTING SYSTEM -

APPLICANT

REGISTERED ENGINEER

Er. R. KUMARIANANDAN,B.E.,M.E.,P.E.,(Dtcp&Corp)
Registered Engineer & Consulting Civil Engineer
DTCP Reg. No.:DTCP/PERUNDURAI/RE-II/003/2021
Erode Corp Reg No : 056/L5/2025/00019
D.No.H40/120, First Floor, Near IOB & BOB Bank,
Opp. Green Park Apartments, Periyar Nagar,
Erode - 638 009, Ph: 9698828102

THE LANDLENS SUITE

Eight ways to know a piece of land before you pay for it.

This report covers one part of the picture. These cover the rest, drawn from the same government records, for any property in Tamil Nadu.

LandLens One
Ask anything about a property and get an answer grounded in live government records, with the sources shown.
/landlens/one

Verify My Land
Every record check run on one property and returned as a single report.
/landlens/verify-my-land

Legal Opinion
An advocate's written opinion on the title, built on the records we pull for it.
/landlens

One Map
Every layer on one map: the parcel, its boundary, zoning, water bodies and what sits around it.
/landlens/one/map

PriceMap
What land actually changed hands for around this plot, taken from the registered deeds.
/landlens/pricemap

Build Scope
What you are allowed to build here: floor space, height, coverage and setbacks.
/landlens/build-scope

Property Tracker
Watch a property and hear about it when something new is registered against it.
/landlens/property-tracker

Deal Room
Run the transaction in one place: documents, stamping, signatures and the parties.
/landlens/deal-room

FREE TOOLS · NO ACCOUNT NEEDED

Twenty-four checks you can run yourself, at no cost.

Records and verification

The registers themselves, read for you.

- Encumbrance Certificate
- Patta and Chitta
- Field Measurement Sketch
- EC Analyzer
- Bank charge check
- Court case search
- Seller background check
- Approval check by survey

Value and duty

What it is worth and what it costs to register.

- Guideline value by street
- Guideline value by survey
- Stamp duty and registration fees
- Capital gains
- Floor space index
- Area unit converter

Zoning and land use

What the plan says can happen on this land.

- Land use zone finder
- CMDA land use check
- Coastal regulation zone
- Master plan check
- Water bodies finder
- Airport height clearance

Registers and directories

Who holds it, and which office keeps the record.

- Find your registering office
- Temple property check
- Waqf property check
- RERA register

Every free tool
/tools

Services we run for you
/services

The LandLens suite
/landlens/one

Verified RealEstate™

Every claim in this document traces back to a government record.

- Legal opinions, due diligence and title verification
- Building plan, layout and sub-division approvals
- Completion and occupancy certificates, regularisation
- Escrow, negotiation and NRI property management
- Land survey, soil testing, architecture and construction

Verified RealEstate
3/350/2 Mettukuppam,
OMR Thoraipakkam,
Chennai 600 097, India
hello@verified.realestate
+91 9996 12 9996

Prepared from the registers named on the page each finding sits on. Where a register could not be read, this document says so in its place rather than leaving the gap to be read as a clean result.